Permanent Magnet and Magnetic Particle Clutches and Brakes





Precision Tork

Permanent Magnet
Clutches and Brakes

Precision Tork units provide constant torque independent of slip speed. They offer excellent overload and jam protection for all drivetrain components and also provide soft starts with zero slip when a preset torque is reached. Precision Tork permanent magnet clutches and brakes do not require maintenance and provide extremely long life.

Magnetic Particle Clutches and Brakes



Warner Electric Precision Tork magnetic particle clutches and brakes are unique because of the wide operating torque range available. Torque to current is almost linear and can be controlled very accurately. The unique features of the magnetic particle clutches and brakes make them ideal for tension control, load simulation, cycling/indexing, and soft starts and stops.

Magnetic Capping Headsets

Warner Electric Precision Tork Magnetic Capping Headsets are 100% interchangeable with many major OEM headsets. Warner Electric headsets feature constant Smooth Torque Technology. They are easy to install and maintain with little adjustment required. The Precision Tork headset has a unique visual scale for setting both application torque & the top load spring.

Permanent Magn	et Clutches	and	Brakes
-----------------------	-------------	-----	---------------

Features and Benefits	2
Special Applications	2
Applications	3
Specifications	2
Mounting Arrangements	∠
Stainless Steel Designs	5
Hollow Bore Units	7
Solid Shaft Units	8
Mounting Bracket	8
Heat Dissipation Charts	g
Torque Setting Charts	10
Stub Shaft Adapters	11
How to Order	11

Magnetic Particle Clutches and Brakes

Features and Benefits	13
Design and Operation	14
Selection	15
Applications	17
Clutches - Dimensions and Specifications	20
Mounting Bracket	20
Brakes - Dimensions and Specifications	21
Controls	22

Magnetic Capping Headsets

•		
Complete Headset	Replacements	23
Features and Benef	fits	24
Models Available		24
Rebuild Options		25
Chucks		26





Permanent Magnet Clutch and Brakes

Fast, precise torque adjustment!

Precision Tork™ clutches and brakes

Precision Tork units provide constant torque independent of slip speed. They offer excellent overload and jam protection for all drivetrain components and also provide soft starts with zero slip when a preset torque is reached. Precision Tork permanent magnet clutches and brakes do not require maintenance and provide extremely long life.

Features and Benefits

Fast, precise torque adjustment

- Torque is set with a large knurled adjustment ring.
- Infinite adjustability between minimum and maximum settings. This allows units to be fine tuned to your unique requirement.
- Easy to read graduations.

Torque is constant with respect to speed

- By using the Precision Tork unit, you can solve almost any torque control problem.
- Torque is extremely consistent and smooth at low, as well as high speeds.

No external control or power source

- Simple to install
- · Nothing to monitor
- Unaffected by power interruption or power fluctuation
- Safe to use

Dependable performance


- Smallest possible transition from static to dynamic torque. Virtually eliminates the "stick-slip" phenomenon associated with friction devices.
- Long life. The only wearing parts are the ball bearings.
- Extremely accurate. Precision Tork units out perform all other devices at low RPM.

Versatile mounting: Easy to retrofit

- Clutches are available with hollow bores for mounting on motor shafts or jack shafts.
- Bolt circles allow for fixed mounting, adding a pulley, or stub shaft adapters.
- Brakes are available with solid shaft outputs.

Distributor item

- Off the shelf availability.
- Interchangeable with competitors' products.

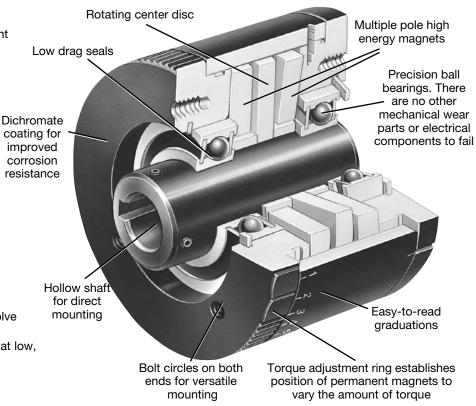

Specials are our business. . .



Applications

Unwind tension control

Brake mounted on shaft of unwind spool or bobbin.



Information required:

Full roll diameter (in.) = 6 in. Core diameter (in.) = 4 in. Average tension (lbs.) = 4 lbs. Velocity (feet per min.) = 100 fpm

How to size:

Average radius (in.) = $\frac{\text{Full roll dia. (in.)} + \text{Core dia. (in)}}{4}$ = $\frac{6+4}{4}$ = 2.5 in.

Torque (lb.in.) =

Avg. tension (lbs.) x Avg. radius (in.) $= 4 \times 2.5 = 10$ lb.in.

Check tension range:

Max. tension = Torque (lb.in.) x

$$\frac{2}{\text{Core dia. (in.)}} = 10 \text{ x } \frac{2}{4} = 5 \text{ lbs.}$$

Min. tension = Torque (lb.in.) x

$$\frac{2}{\text{Full roll dia. (in.)}} = 10 \text{ x } \frac{2}{6} = 3.3 \text{ lbs.}$$


Slip watts =

Max. tension (lbs.) x velocity (fpm) 44.2

= 11.3 watts

Select Model MC4

Cycling

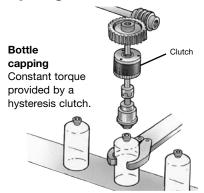

Information required:


Slip RPM = 500 RPM Torque = 8 lb.in. % slip time of total cycle time = 25%

How to size:

*Watts = .0118 x torque (lb.in.) x slip RPM x % slip time = .0118 x 8 x 500 x .25 = 11.8 watts Select MC4 from the specification chart.

*Note: Consult factory if peak slip watts are extremely high or if duration of slip period is in excess of 1 minute.

Nip roll or pulley tension control

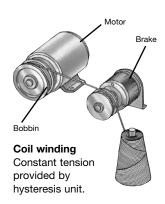



Film tensioning
Constant tensioning
supplied by hysteresis unit.

Information required:

Pulley or nip roll diameter = 4 in. Tension = 6 lbs. Velocity = 100 fpm

How to size:


Torque (lb.in.) = Tension (lbs.) $\times \frac{\text{Dia. (in.)}}{2} = 6 \times \frac{4}{2} = 12 \text{ lb.in.}$

Slip watts = $\frac{\text{Tension (lbs.) x velocity (fpm)}}{44.2} = \frac{6 \times 100}{44.2} = 13.5 \text{ watts}$


Select Model MC5

Overload protection/Torque limiting/Soft start

Motor horsepower method

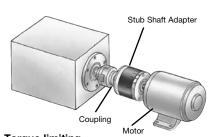

Torque limitingHysteresis clutch provides overload protection.

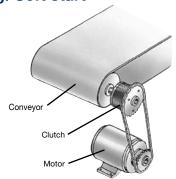

Material handling
Hysteresis clutch can provide overload
protection and soft start.

Information required:

Motor HP = 1/2 HP Motor RPM = 1750 RPM

How to size:

Torque (lb.in.) = $\frac{\text{HP x 63000}}{\text{RPM}}$ = $\frac{1/2 \times 63000}{1750}$ = 18 lb.in.

Select an MC5 from the specification chart.

6/18

Standard Clutches and Brakes

Weight

Bore

Specifications

Model

Torque

Heat

Inertia

Bending

Max



Hollow Bore Configurations

Size		Dissipation (watts)	(lbs. sq. in.)	Moment (lb. in.)	RPM	(lbs.)	Range/Shaft Dia. (in.)
MC1.5	1–13 oz. in.	10	0.02	5	3600	10.5 oz.	1/4
MC2	0.5–22 oz. in.	10	0.02	5	3600	11 oz.	1/4
MC2.5	0.5–5.0 lb. in.	15	0.11	10	1800	1.5	3/8, 1/2
мс3	0.5–6 lb. in.	18	0.14	10	1800	2.5	5/16, 3/8
MC4	0.7–10 lb. in.	22	0.32	10	1800	3.5	3/8, 1/2, 5/8
MC5	1–30 lb. in.	72	1.72	25	1800	9.5	3/8, 1/2, 5/8, 3/4, 7/8, 1
MC5.5	1–50 lb. in.	110	2.74	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
MC6	1–68 lb. in.	150	4.28	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
MC6D	6–136 lb. in.	300	8.52	25	1800	24	1/2, 5/8, 3/4, 7/8, 1
МС9	15–300 lb. in.	345	65.74	50	1200	48	5/8, 3/4, 7/8, 1, 1-1/8, 1-1/4
MB1	0-1.1 oz. in.	3	0.001	1	3600	2.5 oz.	3/16
MB1.5	1–13 oz. in.	10	0.02	5	3600	11 oz.	1/4
MB2	.5-22 oz. in.	10	0.02	5	3600	11.5 oz.	1/4, 3/8
MB2.5	.5–5.0 lb. in.	15	0.11	10	1800	2.5	3/8, 1/2
МВЗ	0.5–6 lb. in.	18	0.14	10	1800	2	3/8
MB4	0.7–10 lb. in.	22	0.33	10	1800	3.5	1/2, 5/8
MB5	1–30 lb. in.	72	1.76	25	1800	10	1
MB5.5	1–50 lb. in.	110	2.79	25	1800	12.5	1
MB6	1–68 lb. in.	150	4.33	25	1800	12	1
MB6D	6–136 lb. in.	300	8.68	25	1800	26	7/8

Solid Shaft Configurations

Typical Mounting Arrangements

MB9

15-300 lb. in.

torque limiting.

345

66.09

50


1200

48

Stub Shaft Adapter


Flexible Coupling

1

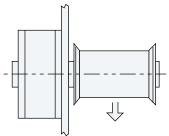


Brake:

Typical setup for tensioning wire, film and fibers.

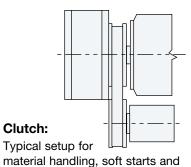

Clutch Coupling:

protection used for labeling, capping and printing applications.

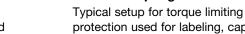

Stainless Steel Clutches and Brakes

Specifications	Model Size	Torque	Heat Dissipation (watts)	Inertia (lbs. sq. in.)	Bending Moment (lb. in.)	Max RPM	Weight (lbs.)	Bore Range/Shaft Dia. (in.)
	MC1.5	1–13 oz. in.	10	0.02	5	3600	10.5 oz.	1/4
-	MC2	0.5–22 oz. in.	10	0.02	5	3600	11 oz.	1/4
Se S	MC2.5	0.5–5.5 lb. in.	15	0.11	10	1800	1.5	3/8, 1/2
	МСЗ	0.5–6 lb. in.	18	0.14	10	1800	2.5	5/16, 3/8
	MC4	0.7–10 lb. in.	22	0.32	10	1800	3.5	3/8, 1/2, 5/8
Hollow Bore	MC5	1–30 lb. in.	72	1.72	25	1800	9.5	3/8, 1/2, 5/8, 3/4, 7/8, 1
Configurations	MC5.5	1–50 lb. in.	110	2.74	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
	MC6	1–68 lb. in.	150	4.28	25	1800	12	3/8, 1/2, 5/8, 3/4, 7/8, 1
	* Size 6	D NS 9 are not	currently ava	ilable as s	tainless ste	el prod	ucts.	
4	MB1	0-1.1 oz. in.	3	0.001	1	3600	2.5 oz.	3/16
	MB1.5	1–13 oz. in.	10	0.02	5	3600	11 oz.	1/4



Solid Shaft Configurations

MB1	0-1.1 oz. in.	3	0.001	1	3600	2.5 oz.	3/16
MB1.5	1–13 oz. in.	10	0.02	5	3600	11 oz.	1/4
MB2	.5-22 oz. in.	10	0.02	5	3600	11.5 oz.	1/4, 3/8
MB2.5	.5–5.5 lb. in.	15	0.11	10	1800	2.5	3/8, 1/2
МВЗ	0.5–6 lb. in.	18	0.14	10	1800	2	3/8
MB4	0.7–10 lb. in.	22	0.33	10	1800	3.5	1/2, 5/8
MB5	1–30 lb. in.	72	1.76	25	1800	10	1
MB5.5	1–50 lb. in.	110	2.79	25	1800	12.5	1
MB6	1–68 lb. in.	150	4.33	25	1800	12	1

www.warnerelectric.com P-1316-WE 6/18


Stainless steel clutches and brakes for harsh environments

Caustic washdown solutions can cause corrosion and eventual failure in food processing applications such as meat and poultry. That's why we have introduced a new line of all stainless steel clutches and brakes. These units, featuring 400 series stainless steel bearings, are robust enough to handle the most hostile washdown environments and tough enough to perform 24/7.









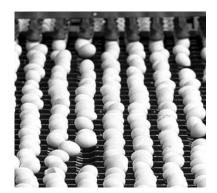

Hollow Bore Configurations

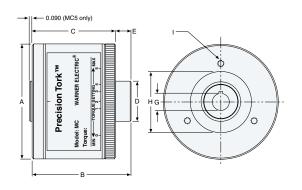

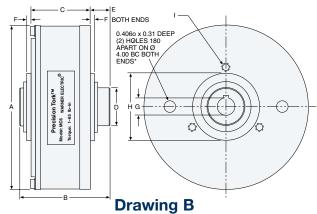

Drawing A

*Set screw adjustment

*Spanner wrench adjustment


				-			
Model	Drawing	Α	В	С	D	E	F
MC1.5	Α	1.85	1.62	1.38	0.375	0.24	-
MC2	Α	1.85	1.62	1.35	0.375	0.27	-
MC2.5	Α	2.31	2.52	2.23	0.79	0.29	_
MC3	Α	2.74	2.22	1.98	0.590	0.24	-
MC4	Α	3.23	2.27	2.01	0.98	0.26	_
MC5	Α	4.65	3.18	2.64	1.372	0.45	-
MC5.5	Α	5.29	3.21	2.64	1.372	0.57	_
MC6	В	6.05	3.18	2.02	1.372	0.76	0.18
MC6D	В	7.15	5.03	4.06	1.378	0.29	0.29
MC9	В	9.40	4.18	3.49	1.77	0.56	0.13


Bore & Keyseat Sizes

Model	Keyseat	Lockdown Method	G (Bore)	H (Pilot-Both Ends)	l (Both Ends)
MC1.5 MC2	None None	3/32 Roll Pin 3/32 Roll Pin	1/4 1/4	0.877-0.876 x 0.08 dp 0.877-0.876 x 0.08 dp	3) 6-32 x 5/16 dp 1.25 B.C. 3) 6-32 x 5/16 dp 1.25 B.C.
MC2.5	None 1/8 Key	2) Set Screws2) Set Screws	3/8 1/2	1.655-1.653 x 0.10 dp	3) 10-32 x 7/16 dp 1.875 B.C.
МС3	None None	2) Set Screws2) Set Screws	5/16 3/8	1.383/1.381 x .120 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MC4	None 1/8 Key 3/16 Key	2) Set Screws2) Set Screws2) Set Screws	3/8 1/2 5/8	1.854–1.852 x 0.08 dp	3) 10-32 x 7/16 dp 2.375 B.C.
MC5	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws	3/8 1/2 5/8 3/4 7/8 1	2.441/2.440 x .10 dp	3) 10-32 x 1/2 dp 3.00 B.C.
MC5.5	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws	3/8 1/2 5/8 3/4 7/8	2.441/2.440 x .26 dp	3) 10-32 x 1/2 dp 3.00 B.C. and 3) 5/16–18 x 0.62 dp 3.50 B.C.
MC6	None 1/8 Key 3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws	3/8 1/2 5/8 3/4 7/8	2.441/2.440	3) 1/4-20 x 5/16 dp 2.875 B.C.
MC6D	3/16 Key 3/16 Key 3/16 Key 1/4 Shallow	2) Set Screws 2) Set Screws 2) Set Screws 2) Set Screws	5/8 3/4 7/8 1	3.250/3.248	3) 5/16-18 x 1/2 dp 4.00 B.C.
MC9	3/16 Key 3/16 Key 3/16 Key 1/4 Key 1/4 Key 1/4 Key	2) Set Screws	5/8 3/4 7/8 1 1-1/8 1-1/4	3.250/3.248	4) 5/16–18 x 1/2 dp 5.875 B.C. and 3) 5/16-18 x 1/2 dp 4.25 B.C.

' www.warnerelectric.com P-1316-WE 6/18

Solid Shaft Configurations

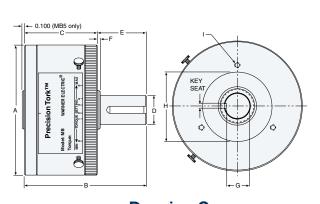

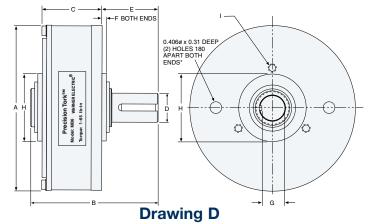


Drawing C

*Thumb screw adjustment

*Spanner wrench adjustment

Model	Drawing	Α	В	С	D (Shaft)	E	F	G	KEY SEAT	H (Pilot-Both Ends)	l (Both Ends)
MB1	С	0.99	1.37	0.86	3/16	0.51	-	0.170 Flat	-	0.300/0.302 x 0.12 dp	3) 4-40 x 1/4 dp 0.610 B.C.
MB1.5	С	1.85	2.36	1.38	1/4	.98	-	0.230 Flat	-	0.876/0.877 x 0.08 dp	3) 6-32 x 5/16 dp 1.250 B.C.
MB2	С	1.85	2.36	1.35	1/4	1.01	-	0.230 Flat	-	0.876/0.877 x 0.08 dp	3) 6-32 x 5/16 dp 1.250 B.C.
IVIDZ	С	1.85	2.36	1.35	3/8	1.01	_	0.355 Flat	-	0.876/0.877 x 0.08 dp	3) 6-32 x 5/16 dp 1.250 B.C.
MB2.5	С	2.31	3.35	2.23	3/8	1.12	-	0.355 Flat	-	1.653/1.655 x 0.10 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MD2.3	С	2.31	3.35	2.23	1/2	1.12	-	0.430/0.414	0.125	1.653/1.655 x 0.10 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MB3	С	2.74	3.02	1.98	3/8	1.04	0.04	0.355 Flat	-	1.383/1.381 x 0.12 dp	3) 10-32 x 7/16 dp 1.875 B.C.
MB4	С	3.23	2.98	2.01	1/2	0.97	0.09	0.430/0.414	0.125	1.852/1.854 x 0.08dp	3) 10-32 x 7/16 dp 2.375 B.C.
WD4	С	3.23	2.98	2.01	5/8	0.97	0.09	0.518/0.502	0.188	1.852/1.854 x 0.08dp	3) 10-32 x 7/16 dp 2.375 B.C.
MB5	С	4.65	4.48	2.64	1	1.75	0.12	0.860/0.844	0.250	2.441/2.440 x 0.100 dp	3) 10-32 x 1/2 dp 3.000 B.C.
MB5.5	С	5.29	4.53	2.65	1	1.88	0.25	0.860/0.844	0.250	2.441/2.440 x 0.26 dp	3)10-32 x 1/2 dp 3.000 B.C. and 3) 5/16-18 x 0.62 dp 3.500 B.C.
MB6	D	6.05	4.48	2.02	1	2.06	0.18	0.860/0.844	0.250	2.441/2.440	3) 1/4-20 x 5/16 dp 2.875 B.C.
MB6D	D	8.55	6.23	4.06	7/8	1.81	0.24	0.771/0.755	0.188	3.250/3,248	3) 5/16-18 x 1/2 dp 4.000 B.C.
MB9	D	9.40	5.39	3.49	1	1.77	0.13	0.860/0.844	0.250	3.250/3.248	4) 5/16-18 x 1/2 dp 5.875 B.C. and 3) 5/16-18 x 1/2 dp 4.250 B.C.

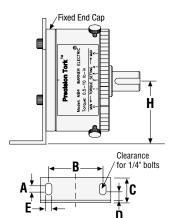

G

Optional Mounting Bracket


Note: Mount bracket to fixed end cap - side opposite knurled adjustment ring.

Model	Fits Size	Α	В	C	D	E	F	G	Н	ı
MPB-2B	MB1.5, 2	0.270	1.750	1.155	0.390	0.280	2.500	0.755	1.500	3.000
MPB-15B	MB2.5/MC2.5, 3, 4	0.270	2.500	1.155	0.390	0.280	3.500	1.130	2.000	4.000
MPB-70B	MB5/	0.270	4.875	1.155	0.390	0.280	6.000	1.630	3.500	6.000
MPB-120B	MB5.5	0.270	4.875	1.155	0.390	0.280	6.000	1.630	3.500	6.250
MPB-240B	MB6	0.270	4.875	1.155	0.390	0.280	6.500	2.445	4.000	7.500

All dimensions are nominal unless otherwise noted. () denotes (mm)


All Brackets are 12 gauge (.105") Steel

Heat Dissipation Charts

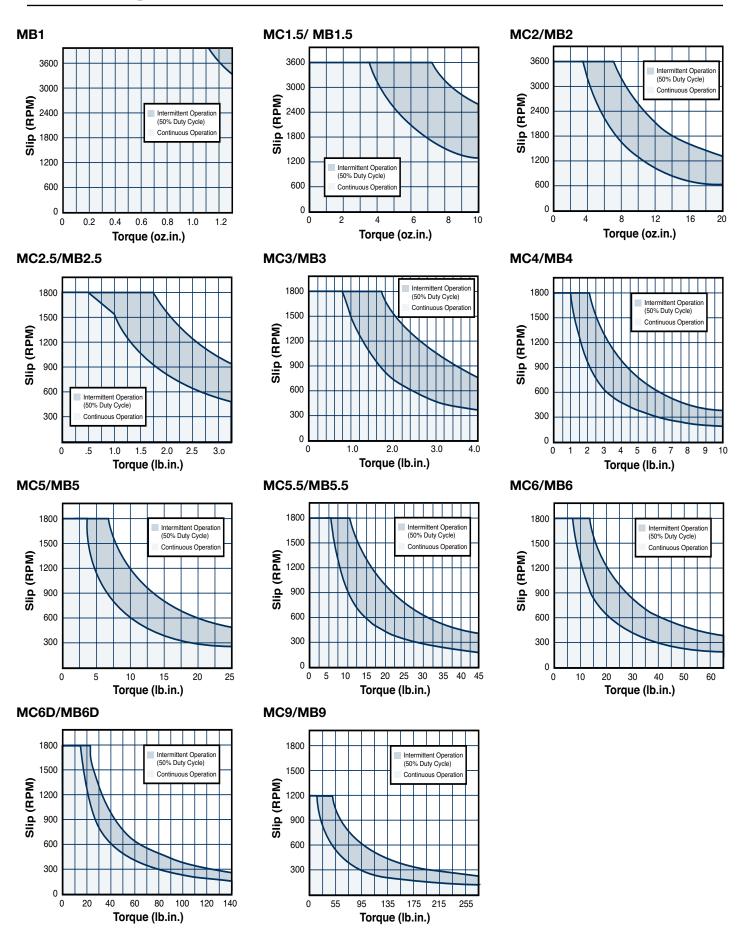


Torque Setting Charts


MB1

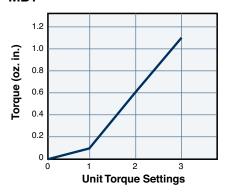


MC2/MB2

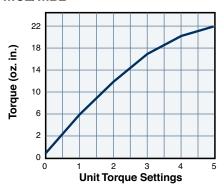


MC2.5/MB2.5

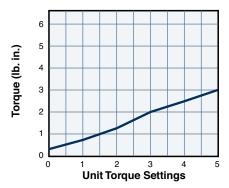


MC3/MB3

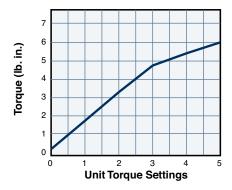


MC4/MB4

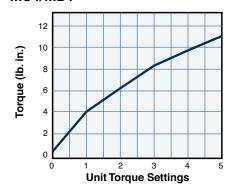


MC5/MB5

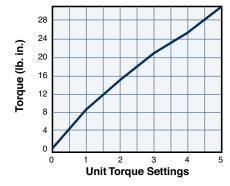


MC5.5/MB5.5

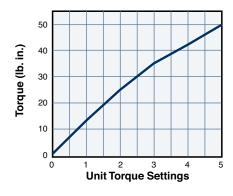


MC6/MB6

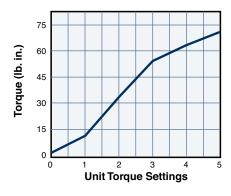

MC6D/MB6D

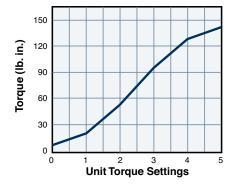


MC9/MB9

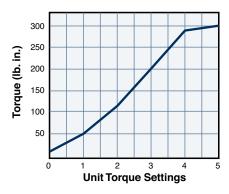

^{*}Torque values are approximate.

Stub Shaft Adapters

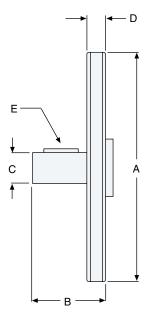



- Utilized when "clutch coupling" configuration is desired.
- Comes complete with attachment hardware and drive key.
- Stub shaft adapters should be used in conjunction with a flexible coupling.
- · Material is Stainless Steel

Adapter Size	Permanent Magnet Model	Α	В	С	D	E
A1-3/16	MB1	0.9	0.88	3/16	0.18	Flat
A2-14	MB1.5/MC1.5/MB2/MC2	1.60	0.78	1/4	0.15	Flat
A2-58	MB1.5/MC1.5/MB2/MC2	1.60	1.15	5/8	0.15	3/16" Key
A3-38	MB3/MC3	2.36	1.19	3/8	0.19	Flat
A4-38	MB4/MC4	2.86	1.19	3/8	0.19	Flat
A5-1	MB5/MC5/MB5.5/MC5.5	3.45	1.72	1	0.27	1/4" Key
A5-12	MB5/MC5/MB5.5/MC5.5	3.45	1.47	1/2	0.27	1/8" Key
A6-34	MB6/MC6	3.40	1.70	3/4	0.35	3/16" Key
A6D-34	MB6D/MC6D/MB9/MC9	4.65	2.50	3/4	0.50	3/16" Key

^{*}If Solid Shaft Series is used with adapter, thumb screw must be removed and replaced with set screws.

How to Order

1. Torque:

Determine the maximum torque that your application requires. See the application example.

2. Energy Dissipation:

Determine the amount of energy or heat that will be generated during operation. Each clutch or brake is rated for a specific amount of energy, given in units of watts, that it can safely dissipate. Energy calculations for common applications are listed in the applications section.

3. Model Selection:

Select the clutch or brake based on torque and energy requirements. See the specifications under "Heat Dissipation and Torque Setting Charts."

4. Select Bore Size:

Select the proper bore size for the application. Although many standard bores are available, consult the factory if your bore requirement is not listed.

5. Example:

Torque Requirement – 9 lb.in. Energy Requirement – 35 watts Bore Requirement – 5/8 inch Select Model MC5-58

I 1 www.warnerelectric.com P-1316-WE 6/18



Magnetic Particle Clutches and Brakes

Accurate torque control with instantaneous engagement!



Warner Electric
Precision Tork
magnetic particle
clutches and brakes are
unique because of the wide operating
torque range available. Torque to
current is almost linear and can
be controlled very accurately. The
unique features of the magnetic
particle clutches and brakes make
them ideal for tension control, load
simulation, cycling/indexing, and soft
starts and stops.

Specials are our business

• Special Shaft Configurations

Customer specified shaft configurations for easy machine mounting and retrofitting.

Special Torque

Maximum torque configurations to meet customer specifications.

Special Mounting Configurations

Customer specified bolt patterns, special mounting brackets.

Metric units

Features and Benefits

· Torque independent of slip speed

Torque is transmitted through magnetic particle chains which are formed by an electromagnetic field. The torque is independent of slip speed, depending only on circuit current, and is infinitely variable from 0 (disengaged) to rated torque.

• Precise engagement

Precision Tork magnetic particle clutches and brakes engage to transmit torque with speed and precision. Response of the particles to the field is virtually instantaneous, providing perfectly controlled, jerk-free engagement.

• Customer specified engagement

Engagement time may be very gradual or extremely fast. The frequency and torque of the engagement/disengagement sequence is limited only by the capabilities of the control circuitry.

No wearing parts

There are no friction surfaces to grab or wear, and the units are not affected by changes in atmospheric or other environmental conditions.

• Efficient/Compact design

High torque to size ratio and low consumption of electric power.

• Versatile mounting

Convenient bolt circle for easy mounting. Mounting brackets available for all sizes. Brakes are available with solid shafts and through bore. Can be mounted


horizontally or vertically to solve virtually any motion control requirement.

Distributor Item

Off the shelf availability. Interchangeable with industry standard sizes.


13 www.warnerelectric.com P-1316-WE 6/18

The inside story.

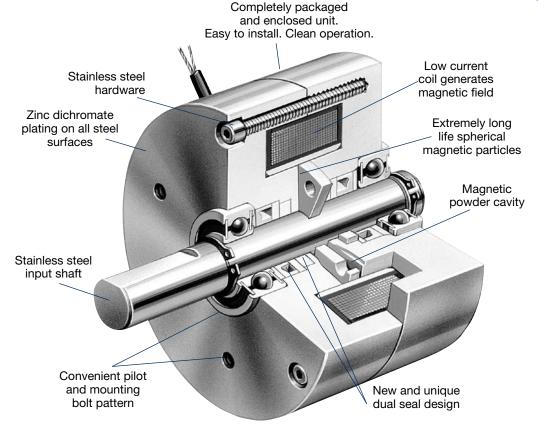

Operating Principles

The magnetic particle unit consists of four main components: 1) housing; 2) shaft/disc; 3) coil and 4) magnetic powder. The coil is assembled inside the housing. The shaft/disc fits inside the housing/coil assembly with an air gap between the two; the air gap is filled with fine magnetic powder.

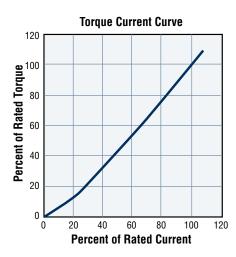

Engagement


When DC current is applied to the magnetic particle unit, a magnetic flux (chain) is formed, linking the shaft/disc to the housing. As the current is increased the magnetic flux becomes stronger, increasing the torque. The magnetic flux creates extremely smooth torque and virtually no "stick-slip".

Disengagement

When DC current is removed the magnetic powder is free to move within the cavity, allowing the input shaft to rotate freely.

Cycling

By turning the current to the coil on and off a cycling effect is achieved.

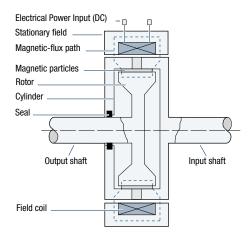

Selection

Sizing

To properly size magnetic particle clutches or brakes the thermal energy (slip watts) and torque transmitted must be considered. If thermal energy and torque are known for the application select the unit from the charts to the right.

RPM

RPM must be known when calculating thermal energy (slip watts). For load simulation, torque limiting and similar applications, RPM is known. For web handling, the RPM is calculated as follows:

Slip RPM* =
$$\frac{12 \text{ x Velocity (feet per min.)}}{\pi \text{ x Full Roll Dia.** (in.)}}$$

*In rewind applications the motor RPM should be higher (10%) than the fastest spool RPM.

**In applications with the web running over a pulley or in a nip roll application use the pulley diameter

Thermal Energy (slip watts)

as the roll diameter.

Tension applications are considered continuous slip applications. When a brake or clutch is slipping, heat is generated. Heat is described in terms of "energy rate" and is a function of speed, inertia, and cycle rate. Heat generated is usually described in terms of thermal energy or slip watts. Starting and stopping applications generate heat when the unit slips during the stopping and starting of the load.

• For continuous slip applications, such as tension control in an unwind or rewind application slip watts are calculated using the following formula:

Slip Watts = .0118 x Torque (lb.in.) x Slip RPM

• For cycling applications heat is generated intermittently, and is calculated using the following formula:


Watts = 2.67 x Inertia (lb.in.²)

$$x\left(\frac{RPM^2}{10.000}\right)x F \frac{cycle}{min}$$


Duty Cycle

The average heat input must be below the clutch or brake's heat dissipation rating. If the application generates intermittent heat dissipation, use the average speed for the thermal energy (slip watts) calculations.

Quick Selection Charts

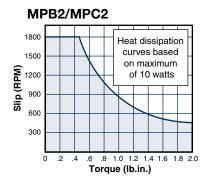

MPB25/MPC25 Heat dissipation curves based on maximum of 20 watts 400 200 5 10 15 20 25 Torque (lb.in.)

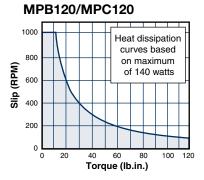


Torque


Tension applications calculate torque as a function of roll radius and tension. Soft/controlled stopping applications calculate torque as a function of inertia, speed and desired time to stop the load. Torque limiting applications calculate torque as the allowable drive through torque. Calculate the torque requirement based on the formulas for the different applications:

• To calculate torque for a web handling application, determine the desired tension in the web then calculate the required torque as follows:


MPB15/MPC15

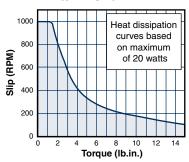

MPB70/MPC70

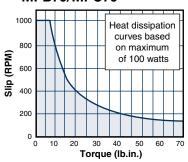

MPB240

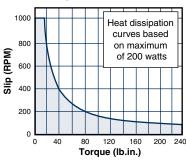


- *Use full roll diameter. In applications with the web running over a pulley or in a nip roll application use the pulley diameter as the roll diameter.
- To calculate torque for soft/controlled stop or cycling applications first determine the inertia (WR²), and apply it to the formula below:

Torque (lb.in.) =
$$\frac{\text{Inertia (lb.in.}^2) \times \text{RPM}}{3,690 \times \text{time(s)}}$$

Inertia (WR2) =

[(weight of body) x (radius of gyration*)]²

*to calculate for a cylinder about its axis: Solid cylinder = $R^2 = 1/2r^2$ Hollow cylinder = $R^2 = 1/2(r_1^2 + r_2^2)$

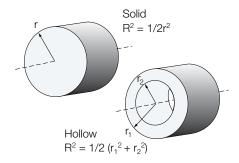

Reflected Inertia (rotational)

In mechanical systems it is common for the rotating parts to operate at different speeds. In clutch and brake applications the WR² is calculated for each part operating at different speeds then reduced to and equivalent WR² at the clutch or brake mounting shaft speed. All the rotating parts WR² are added together and treated as a unit.

The formula for determining the equivalent WR² of a rotating part referred to the clutch or brake shaft is as follows:

$$WR_e^2 = WR^2 x \left(\frac{N}{Ncb}\right)^2$$

Where:

 WR^2 = inertia of the rotating part at N (RPM)

N = speed (RPM) of the rotating part
 N_{Cb} = speed (RPM) of the clutch or brake shaft

Reflected Inertia (linear)

In complex systems involving both linear and rotating motion, the linearly moving parts can be reduced to the clutch or brake speed by the following equation:

$$WR^2e = W x \left(\frac{V}{2\pi N}\right)^2$$

Where:

W = Weight of body

V = Velocity in feet per minute

N = RPM of the clutch or brake shaft

This equation can only be used when the linear speed has a continuous fixed relation to the rotating speed, such as a conveyor driven by a motor.

To determine torque in an overload protection, torque limiting or soft start application use the following equation:

Torque (lb.in.) =
$$\frac{HP \times 63,000}{RPM}$$

Tension Value Chart

Material	tn (lbs.in. of web width)
Aluminum foils	0.5 to 1.5 (1.0 aver.)/mil
Cellophanes	0.5 to 1.0/mil
Acetate	0.5/mil
Mylar (Polyester)	0.25 to 0.30/mil
Polyethylene	0.25 to 0.30/mil
Polypropylene	0.25 to 0.30/mil
Polystyrene	1.0/mil
Saran	0.05 to 0.20
	(0.10 aver.)/mil
Vinyl	0.05 to 0.20
	(0.10 aver.)/mil

Paper and Laminations

20#/R-32.54 gm/m ²	0.50 to 1.0
40#/R-65.08 gm/m ²	1.0 to 2.0
60#/R-97.62 gm/m ²	1.5 to 3.0
$80\#/R - 130.0 \text{ am/m}^2$	2 0 to 4 0

Paper

15	lbs./ream (3,000 sq.	ft.) 0.5
20	lbs./ream	0.75
30	lbs./ream	1.0
40	lbs./ream	1.5
80	lbs./ream	2.5

Laminations

25 lb. paper/.005" PE/.00032" FOIL/.001" PE 3.0 .001" Cello/.0005" PT/.001" Cello 1.5

When these substrates are coated with polyethylene, nylon polypropylene EVA, EAA, and EEA, add the following tension to the values listed above for the substrate only.

Coating Thickness

0.0005" to 0.0001	0.12	
0.0011" to 0.002	0.25	

Calculating Web Tension

For sizing brakes on applications in which the applied web tension is unknown, use the following information to determine the approximate tension value.

Applied Web Tension (lbs.) = Approx. Material Tension (lb.in.)

x Roll Width (in.)

Example:

The tension for a twelve inch wide roll of 20# paper stock is unknown. What is the prescribed tension?

Material	tn (lbs.in. of web width)
Cellophane	
.00075"	0.5
.001"	0.75
.002"	1.0
Nylon and Cast (non-Oriented)	Propylene
.00075"	0.15
.001"	0.25
.002"	0.5
Paperboard	
8 pt.	3.0
12 pt.	4.0
15 pt.	5.0
20 pt.	7.0
25 pt.	9.0
30 pt.	11.0
Mylar and Orier	nted Propylene
0.0005"	0.25
0.001"	0.5
0.002"	1.0
Material	tn (lbs./strand)

Material	tn (lbs./strand)
Aluminum Wire	
#20 AWG	4.00
#18 AWG	5.50
#16 AWG	9.00
#14 AWG	10.00
#12 AWG	12.00
#10 AWG	15.00
#8 AWG	25.00
Copper Wire	
#20 AWG	8.00
#18 AWG	10.00
#16 AWG	12.00
#14 AWG	15.00
#12 AWG	18.00
#10 AWG	20.00
#8 AWG	25.00

Solution:


The approximate tension value as noted in the chart above for 20# paper stock is 0.75 lb.in.; thus the tension for this application is $(0.75 \text{ lb.in.} \times 12) = 9 \text{ lbs.}$

Applications


Warner Electric Precision Tork magnetic particle clutches and brakes are the ideal solution for controlling and maintaining torque. If the application is tensioning, load simulation, torque limiting, or soft starts and stops the magnetic particle unit is the preferred torque controlling device.

Typical Applications

- Wire Processing (winding, hooking, cutting)
- Paper/Foil/Film Processing
- Labeling Applications
- Textile Processing
- Material Processing
- Load profile simulation on:
 - Exercise Equipment
 - Flight Simulators
 - Healthcare Equipment
- · Life testing on:
 - Motors
 - Gears
 - Pulleys
 - Belts
 - Chains
 - Many other Rotating Devices
- Conveyors
- Bottle Capping

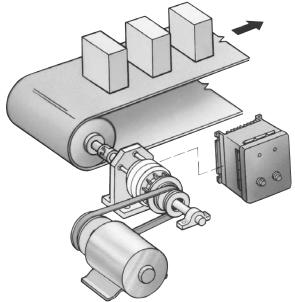

Controlled Acceleration/Deceleration

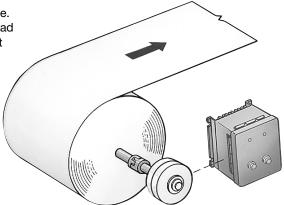

Controlled soft stop

Particle brakes and the CBC300 control provide soft stopping of large rotating loads. By controlling the input current, the load is decelerated in a controlled manner without torque spikes, shock, or vibration.

Application Example:

Information Required:

RPM: 1,000 Time to Stop: 3 seconds Inertia*: 400 lb.in.²

*If inertia is not known see page 4 to calculate.

How to Size:

Maximum Torque (lb.in.) =

= Inertia (lb.in.²) x RPM 3,690 x time(s)

 $= \frac{400 \times 1,000}{3,690 \times 3}$

= 36 lb-in

Select a brake that exceeds the maximum torque requirements from the Specification Chart – MPB70.

Controlled soft start

Particle clutches and the CBC300 control provide soft controlled acceleration to prevent tipping or shock during start up.

Application Example:

Information Required:
RPM: 500
Time to Start: 4 sec.
Inertia*: 50 lb.in.²

*If inertia is not known see page 4 to calculate

How to Size:

Maximum Torque (lb.in.) =

 $= \frac{\text{Inertia (lb.in.}^2) \times \text{RPM}}{3,690 \times \text{time(s)}}$

 $= \frac{50 \times 500}{3,690 \times 4}$


= 1.7 lb.in.

Select a clutch that exceeds the maximum torque requirements from the Specification Chart – MPC2.

17 www.warnerelectric.com

Tensioning

Magnetic Particle clutches and brakes offer smooth controlled torque for tensioning in both the unwind zone and rewind zone. Torque produced from the magnetic particle clutches and brakes is independent of slip speed, offering a distinct advantage over competing technologies. Since torque can be varied infinitely by varying the input current, the magnetic particle clutches and brakes are ideal in an open loop system. To close the loop in the tensioning system, combine the magnetic particle clutch or brake

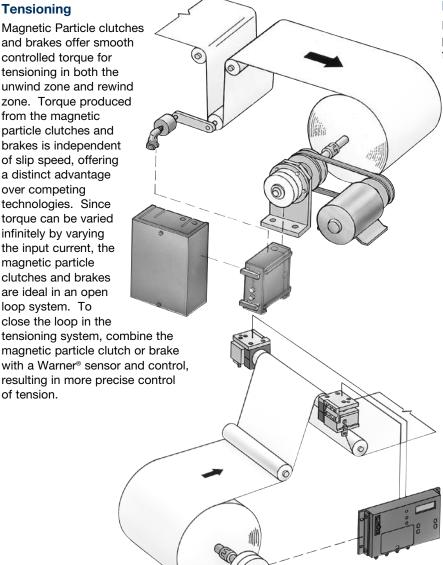

Unwind stand under load cell control

Particle brakes and load cell controls with precision load cell sensors provide closed loop tension control.

Application Example:

Information Required:

Full Roll Diameter: 20 inches Tension: 5 lbs. 400 fpm Velocity:

How to Size:

of tension.

Maximum Torque (lb.in.) =

Full roll diameter (in.) x tension (lbs.)

$$= \frac{20 \times 5}{2}$$

$$= \frac{100}{2}$$
= 50 lb.in.

Slip RPM =
$$\frac{\text{Velocity (fpm) x 12}}{\text{Full roll diameter x }\pi}$$

= $\frac{400 \times 12}{20 \times \pi}$
= 76 RPM

Thermal Energy (Slip Watts) = .0118 x Torque (lb.in.) x RPM

 $= .0118 \times 50 \times 76$

= 45 Watts

Select a brake that exceeds the maximum torque and thermal energy requirements from Quick Selection Chart - MPB70.

Rewind stand under dancer control

Particle clutches and the MCS-203 control provide accurate closed loop tension control for rewind applications.

Application Example:

Information Required:

Core Diameter: 3 inches Full Roll Diameter: 9 inches Tension: 5 lbs. Velocity: 300 fpm Input RPM: 500 RPM*

Maximum Torque (lb.in.) =

tension (lbs.) x full roll diameter (in.)

$$= \frac{5 \times 9}{2}$$
$$= 23 \text{ lb-in}$$

Core RPM =
$$\frac{12 \text{ x Velocity (fpm)}}{\pi \text{ x (core diameter)}}$$

= $\frac{12 \text{ x } 300}{\pi \text{ x } 3}$

= 382 RPM

Full Roll RPM =
$$\frac{12 \text{ x Velocity (fpm)}}{\pi \text{ x Full Roll Dia.}}$$

$$= \frac{12 \times 300}{\pi \times 9}$$

= 127 RPM

Slip RPM = Input RPM - Full Roll RPM

=500 - 127= 372.68

Thermal Energy (slip watts) =

= .0118 x Torque x Slip RPM

 $= .0118 \times 22 \times 373$

= 99 watts

Select a clutch that exceeds the maximum torque and thermal energy requirements from the Quick Selection Chart - MPC120.

*To maximize tension control and minimize heat generated, select a drive system that will result in an actual input speed as close to, but not less than, 30 RPM greater than the core RPM. In this example, 382 + 30 = 412, would be ideal but 500 RPM was more readily available.

Applications

Torque Limiting/ Overload Protection

The magnetic particle clutches and brakes combined with a Warner® CBC control are effective means to providing protection in the case of jam ups. The magnetic particle clutch and the CBC control can provide precise adjustable torque in torque limiting applications.

Application Example

Information Required:
Motor HP: 1 HP
Motor RPM: 700 RPM

How to Size:


Maximum Torque (lb.in.) =

 $= \frac{HP \times 63,000}{RPM}$

= $\frac{1 \times 63,000}{700}$

90 lb.in.


Select a clutch that exceeds the maximum torque requirements from the Selection Chart – MPC120.

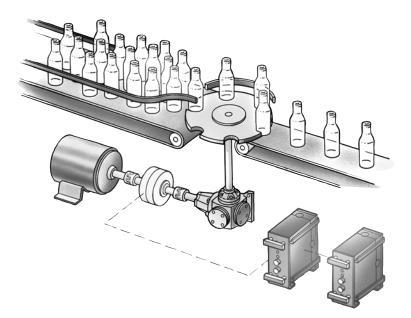

Load Simulation

By combining the magnetic particle brake with a microprocessor control, virtually any load simulation can be obtained. The control is programmed with the profile or condition that is to be simulated. The control then feeds the profile to the magnetic particle brake in terms of input current. The brake reads the input current and provides load torque to simulate the condition.

If the application requires programming load profiles, adjusting load torque, or simulating friction or drag loads, the magnetic particle clutches and brakes are the ideal solution.

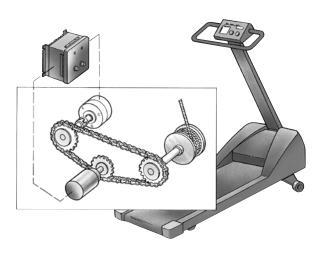


Exercise Equipment

Brake models provide a smooth controllable resistance for exercise machines. When integrated with a microprocessor control, programming load profiles is possible.

www.warnerelectric.com

Dimensions and Specifications

Clutches

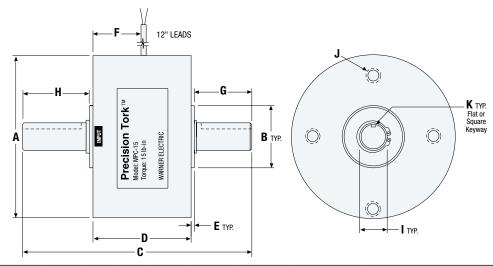


Dimensions

Model	A	В	С	D	E	F	G (Output)	H (Input)	ı	J	K5
MPC2-1	2.11	0.750/0.749	3.73	1.85	0.06	1.16	0.88	0.88	0.2498/0.2492	(3) #6-32 x 0.50 on 1.350 BC	Flat
MPC15-1	2.96	1.125/1.124	4.93	2.80	0.07	1.69	1.00	1.00	0.4998/0.4992	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC15-2	2.96	1.125/1.124	5.08	2.80	0.07	1.69	1.22	0.92	0.3748/0.3742	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC25-1	2.96	1.125/1.124	4.93	2.80	0.07	1.69	0.995	1.00	0.4998/0.4992	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC25-2	2.96	1.125/1.124	5.08	2.80	0.07	1.69	1.22	0.92	0.3748/0.3742	(3) #8-32 x 0.50 on 2.000 BC	2 Flats at 90°
MPC70	4.58	1.625/1.624	6.55	3.67	0.10	2.08	1.35	1.35	0.7497/0.7492	(4) #10-32 x 0.63 on 4.228 BC	0.188 Keyway
MPC120	5.25	1.625/1.624	7.02	4.00	0.10	2.40	1.50	1.35	0.7497/0.7492	(4) #1/4-20 x 0.75 on 4.812 BC	0.188 Keyway
MPC240	6.23	2.4415/2.4405	8.35	4.83	.10	2.62	1.66	1.66	.7495/.7485	(4) #1/4-20 X 0.65 on 5.875 BC	0.188 Keyway

Specifications

Model Number	Max. Drag Torque 0 Excit. (lb.in.)	Rated Torque (lb.in.)	Rated Voltage	Resistance (Ohms)	Rated Current (Amps)	Response Zero Force (Millisec)	Response With Force (Millisec)	Inertia of Output Shaft (lb.in.2)	Max. Heat Dissipation (watts)	Max. Speed Recom. (RPM)	Weight
MPC2	0.40	2	24	92	0.261	8	4	0.001	10	1,800	2
WPU2	0.40	2	90	1552	0.058	8	4	0.001	10	1,800	2
MPC15	0.40	15	24	80	0.302	25	9	0.013	20	1,000	5.5
WPG15	0.40	15	90	1501	0.060	25	9	0.013	20	1,000	5.5
MPC25	0.40	25	24	45	0.533	25	9	0.013	20	1,000	5.5
IVIPU23	0.40	25	90	430	0.533	25	9	0.013	20	1000	5.5
MPC70	1.00	70	24	35	0.677	70	17	0.073	100	1,000	16
WPC/U	1.00	70	90	613	0.147	70	17	0.073	100	1,000	16
MPC120	2.00	120	24	33	0.742	90	25	0.370	140	1,000	22
WFG12U	2.00	120	90	475	0.190	90	25	0.370	140	1,000	22
MPC240	2.00	240	24	19.5	1.20	150	45	1.33	200	1000	37
WFU24U	2.00	240	90	225.5	0.400	150	45	1.33	200	1000	37

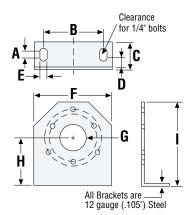


Optional Mounting Bracket (for mounting MPB Brakes and MPC Clutches)

Model	Fits Size	A	В	C	D	E	F	G	Н	I
MPB-2B	2	0.270	1.750	1.155	0.390	0.280	2.500	0.755	1.500	3.000
MPB-15B	15, 25	0.270	2.500	1.155	0.390	0.280	3.500	1.13	2.000	4.000
MPB-70B	70	0.270	4.875	1.155	0.390	0.280	6.000	1.63	3.500	6.000
MPB-120B	120	0.270	4.875	1.155	0.390	0.280	6.000	1.63	3.500	6.250
MPB-240B	240	0.270	4.875	1.155	0.390	0.280	6.500	2.245	4.000	7.500

All dimensions are nominal unless otherwise noted.

Dimensions and Specifications

Brakes

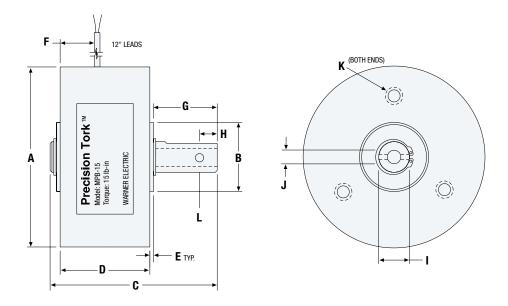

Dimensions

Model	Α	В	C	D	E	F	G	Н	I (Shaft)	J (Bore)	K	L
MPB2-1	2.11	0.750/0.749	2.23	1.15	0.06	0.70	0.87	-	0.2498/0.2492	-	(3) #6-32 x 0.27 on 1.350 BC	1 Flat
MPB15-1	2.96	1.125/1.124	3.05	1.46	0.07	0.85	1.35	-	0.3748/0.3742	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB15-2	2.96	1.125/1.124	2.05	1.46	0.07	0.85	0.34	0.18	-	0.375/0.376	(3) #8-32 x 0.30 on 2.000 BC	0.125 Thru Hole
MPB15-3	2.96	1.125/1.124	2.70	1.46	0.07	0.85	0.99	-	0.4998/0.4992	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB25-1	2.96	1.125/1.124	2.05	1.46	0.07	0.85	1.35	-	0.3748/0.3742	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB25-2	2.96	1.125/1.124	2.05	1.46	0.07	0.85	0.34	0.18	-	0.375/0.376	(3) #8-32 x 0.30 on 2.000 BC	0.125 Thru Hole
MPB25-3	2.96	1.125/1.124	2.7	1.46	0.07	0.85	0.99	_	0.4998/0.4992	-	(3) #8-32 x 0.30 on 2.000 BC	2 Flats at 90°
MPB70-1	4.57	1.625/1.624	2.62	1.76	0.10	0.98	0.50	0.18	-	0.500/0.501	(4) #10-32 x 0.50 on 4.228 BC	0.125 Thru Hole
MPB70-2	4.57	1.625/1.624	3.37	1.76	0.10	0.98	1.25	-	0.7497/0.7492	-	(4) #10-32 x 0.50 on 4.228 BC	0.188 Keyway
MPB70-3	4.57	1.851/1.850	3.00	1.76	0.10	1.01	0.85			0.6258/0.6252	(4) #10-32 x 0.50 on 4.228 BC	0.188 Keyway
MPB120-1	5.25	1.625/1.624	4.02	2.17	0.10	1.18	1.50	0.50	-	0.500/0.501	(4) #1/4-20 x 0.75 on 4.812 BC	0.156 Thru Hole
MPB120-2	5.25	1.625/1.624	4.02	2.17	0.10	1.18	1.50	-	0.7497/0.7492	-	(4) #1/4-20 x 0.75 on 4.812 BC	0.188 Keyway
MPB120-3	5.25	3.186/3.184	3.30	2.17	0.09	0.95	0.85			0.626/0.625	(2) #1/4-20 x 1.07 on 4.850 BC	0.188 Keyway
MPB240-1	6.23	2.442/2.440	4.66	2.65	0.10	1.46	1.65	-	0.7497/0.7492	-	(4) #1/4-20 x 0.65 on 5.875 BC	0.188 Keyway
MPB240-2	6.23	2.442/2.440	3.51	2.65	0.10	1.46	0.50	-		0.875/0.876	(4) #1/4-20 x 0.65 on 5.875 BC	0.188 Keyway
MPB240-3	6.23	2.442/2.440	3.51	2.65	0.10	1.46	0.50	-	-	1.000/1.001	(4) #1/4-20 x 0.65 on 5.875 BC	0.250 Shallow Keyway

Specifications

-											
Model Number	Max. Drag Torque 0 Excit. (lb.in.)	Rated Torque (lb.in.)	Rated Voltage	Resistance (Ohms)	Rated Current (Amps)	Response Zero Force (Millisec)	Response With Force (Millisec)	Inertia of Output Shaft (lb.in.2)	Max. Heat Dissipation (watts)	Max. Speed Recom. (RPM)	Weight
MPB2	0.40	2	24	92	0.261	8	4	0.001	10	1,800	1
IVIPDZ	0.40	2	90	1552	0.058	8	4	0.001	10	1,800	1
MPB15	0.40	15	24	80	0.302	25	9	0.013	20	1,000	2.5
IVIPDIO	0.40	15	90	1501	0.060	25	9	0.013	20	1,000	2.5
MDDOC	0.40	25	24	45	0.533	25	9	0.013	20	1,000	2.5
MPB25	0.40	25	90	430	0.060	25	9	0.013	20	1000	2.5
MPB70	1.00	70	24	35	0.677	70	17	0.073	100	1,000	8
IVIPD/U	1.00	70	90	613	0.147	70	17	0.073	100	1,000	8
MDD400	2.00	120	24	33	0.742	90	25	0.370	140	1,000	12.5
MPB120	2.00	120	90	475	0.190	90	25	0.370	140	1,000	12.5
MPB240	4.00	240	24	19	1.286	150	45	1.311	200	1,000	20.5
WPB24U	4.00	240	90	246	0.366	150	45	1.311	200	1,000	20.5

Www.warnerelectric.com P-1316-WE 6/18

Adjustable Torque



TCS-200-1 Manual/Analog

The TCS-200-1/-1H single channel controls are selectable voltage or current controlled power supplies designed to power up to a 16-magnet Electro Disc tension brake system, Electromagnetic Particle Brakes, TB Series brakes, or Advanced Technology tension brakes. These controls operate from a switch-selectable power source of 115 or 230 VAC. They can be operated manually from the front panel or remotely via an analog voltage input, a current input, a remote pot, or a roll follower, External inputs are also provided for remote brake Off, Run, and Stop functions, as well as front panel control of these functions.

Features

- Input: 115/230 VAC, 50/60 Hz
- Output: -1, 0-24 VDC adjustable, 4.25
 Amps continuous
 -1H, 0-24 VDC adjustable, 5.8
 Amps continuous
- Front panel torque adjust
- Front panel brake mode stop switch
 Modes: Stop Brake Full On
 Run Normal Operation
 Off Brake Off
- Remote brake mode switch (same functions as mentioned above)
- Remote torque adjust
- Roll follower input
- 0–10 VDC analog voltage input
- 4–20mA analog current input

System Control



CBC200/CBC300

The CBC 200 and CBC 300 are Constant Current controls for 90 volt coil clutches and brakes. Both can control a single clutch or brake, or a clutch and brake or two clutches or two brakes.

Both operate based on 120 volt AC input. The CBC 200s have one output channel adjustable and one fixed. The CBC 300s have both channels adjustable.

The CBC 200 and CBC 300 provide for potentiometer adjustment on the front of the unit as shown.

The CBC 200-1 and CBC 300-1 provides for input from an external 10K ohm, 2 watt potentiometer.

The CBC 200 C1 and CBC 300 C1 are chassis mount versions of the CBC 200-1 and CBC 300-1.

Features

- Input: 115 VAC 50/60 hz
- Output: Pulse width modulated full wave rectified DC. Constant current, switch selectable ranges designed for 90 volt DC clutches and brakes.
- Circuit Protection: Internal short circuit protection on outputs, but no circuit protection for AC ground faults. Customer supplied 1.5 amps 250 VAC Fast Acting type fuse recommended.
- Status Indicators: "POWER" green LED indicating AC power is applied to the control. "SHORT" red LED indicating that a short circuit condition exists on one or both of the outputs.
- Enclosure: NEMA 1 rated.
- External switching: Mechanical or Electromechanical switching.
 Customer supplied 1 amp, 125 v minimum rating

Dancer/Remote Analog Control



MCS-203/MCS-204/ MCS-166

The MCS-203 is a basic dancer control that automatically controls web tension through the use of a dancer roll and sensor. It is single channel, but can operate two 24 VDC tension brakes in parallel when using two MCS-166 power supplies.

The MCS-204 is a basic remote analog control that can also be operated manually via a front panel tension adjustment potentiometer. It is also single channel with the possibility of operating two 24 VDC tension brakes in parallel when using two MCS-166 power supplies.

Features

- Input: 115/230 VAC, 50/60 Hz
- Output: 0-24 VDC at 3 Amps max.

MCS-203 (only)

- Full P-I-D adjustment
- System gain display

MCS-204 (only)

- Front panel torque adjustment
- Remote potentiometer adjustment
- Roll follower input
- Remote voltage or current analog signal following

Magnetic Capping Headset Replacements

Warner Electric's unique product design enables longer life for your magnetic headset.

Spring Cover

Keeps lubrication within the unit, extends the life of the top load components.

Stainless Steel Construction, Quad Seal, and Drain Holes

The quad seal helps to protect the bearing from contaminants. The drain holes allow for an exit if any fluids get inside of the unit. These features combined with stainless steel construction enable the units to better withstand harsh environments, including caustic washdowns!

Visual Setting Scale for Application Torque

Easy to set up and maintain. This setting scale provides easy, accurate setting of application torque.







Visual Setting Scale for Setting Top Load Force

Easy to set up. This setting scale provides easy accurate setting of top load force.

Oversized Thrust Bearing

Specifically designed for the bottling industry with an oversized thrust bearing to handle the repeated downward thrust of capping, increasing bearing life compared to a standard radial ball bearing used by competitive models.

This bearing is not incorporated on all models.

Smooth Torque Technology

Eliminates cap over-tightening, reduces variation in removal torque, and provides less shock wear on the system.

Lifetime Sealed Magnets

- Reduced maintenance costs
- Never need to be replaced

Push Button Torque Control Optional Feature

Quick torque changeover.



www.warnerelectric.com P-1316-WE 6/18

Magnetic Capping Headset Replacements


Featuring Smooth Torque magnetic technology to provide the most consistent torque control on the market

Warner Electric magnetic headsets feature constant Smooth Torque Technology; differing with most competitor OEM headsets that have two opposing magnets causing pulsating torque. It's the pounding effect of a pulsating clutch that increases cap tightness during the capping process.

Warner Electric's Smooth Torque Technology enables Warner headsets to provide constant torque. This eliminates over tightened caps, causing a major reduction in variation of removal torque!

Smooth Torque Technology provides less shock on the system compared to pulsating torque headsets, enabling longer life of machine components, especially retention knives.

- 100% Interchangeable with Major OEM Headsets
- Smooth Torque
- Improved Efficiency
- Longer Operating Life and Lower Cost of Ownership
- Lower Operating Costs
- Easy to Set-up & Maintain
- Excellent Service Expertise and Delivery

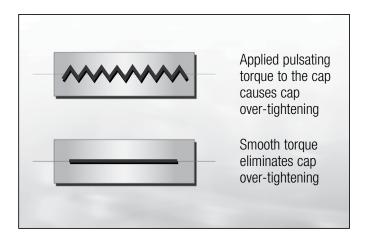


Warner Electric capping headsets are 100% interchangeable with major OEM models including:

- ALCOA
- ZALKIN
- AROL
- FOWLER

- FOGG
- AMCO
- KRONES
- KHS

Many Warner headsets available off the shelf!

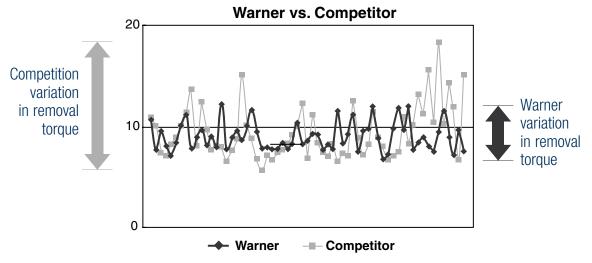

Each data point is a measurement from one sample bottle from competitive headsets running on the same machine.

Rebuild Options

Rebuild Options for Warner Electric Magnetic Headsets

Headset Rebuild Kits: Low cost, easy to rebuild in house!

Bearing kits and magnet kits in stock

Headset Factory Repair Program: Low cost, quick turnaround!

 Ship headsets back to Warner Electric for a full factory rebuild and certification

Headset Exchange Programs: Choose the program that best meets your needs!

- Complete exchange program options available for magnetic headsets
- Multi-year exchange programs enable customers to receive rebuilt Warner headsets at predetermined times during the year in exchange for their used headsets

On site Service Technician Support: Get extra help when you need it!

- On-site service support is available for installation of new Warner headsets, rebuild support of existing Warner headsets, training, etc.
- Our factory-trained and certified service department with over 50 years combined experience can help prevent costly delays and down time of your capping operation

Easy Rebuilds!

- Full rebuild kits available
- No expensive maintenance contracts
- Save time and money by repairing the headsets yourself

Other Rebuild Options

- Factory Repair Programs
- Exchange Program
- Ask for details



www.warnerelectric.com P-1316-WE 6/18

Warner Electric is your Engineered Cap Chuck Solution

- Chucks engineered to fit your cap profile
- Manufactured to be 100% interchangeable with existing OEM chucks
- Manufactured from highly corrosion resistant hardened stainless steel material
- Unique cap chuck pin designed to better grip your cap
- · Competitively priced and short lead times
- Experienced in providing quality chucks for new low profile cap applications
- Our extensive design experience has enabled us to engineer our chucks to reduce cocked caps



Fixed Chucks



- Simple design, least amount of wearing parts
- · Low maintenance
- · Low inertia
- · Short lead times

Quick Connect Chucks



- Quick changeover ideal for multiple package sizes or frequent cleaning
- Designed for any OEM headset to meet your application needs





- Ideal for multiple capsizes, difficult cap grip applications, and smooth caps
- Hardened stainless steel used in key wear areas
- · Competitively priced



Notes	

27 www.warnerelectric.com P-1316-WE 6/18



Notes

29 www.warnerelectric.com P-1316-WE 6/18

The Power Of One, The Strength Of Many.

OTHER PRODUCT SOLUTIONS FROM

ALTRA INDUSTRIAL MOTION

WWW.ALTRAMOTION.COM

Our comprehensive product offerings include various types of clutches and brakes, overrunning clutches, engineered bearing assemblies, gearing and gear motors along with linear products, belted drives, couplings and limit switches. With thousands of product solutions available, Altra provides true single source convenience while meeting specific customer requirements. Many major OEMs and end users prefer Altra products as their No. 1 choice for performance and reliability.



ELECTRIC CLUTCHES AND BRAKES

Inertia Dynamics Matrix Stromag Warner Electric



ENGINEERED COUPLINGS AND UNIVERSAL JOINTS

Ameridrives
Bibby Turboflex
Guardian Couplings
Huco
Lamiflex Couplings
Stromag
TB Wood's



HEAVY DUTY CLUTCHES AND BRAKES

Industrial Clutch Stromag Svendborg Brakes Twiflex Wichita Clutch



GEAR DRIVES

Bauer Gear Motor Boston Gear Delroyd Worm Gear Nuttall Gear



OVERRUNNING CLUTCHES

Formsprag Clutch Marland Clutch Stieber



GEAR MOTORS

Bauer Gear Motor











POWER TRANSMISSION COMPONENTS

LINEAR ACTUATORS AND CONTROLS

Warner Linear

ENGINEERED BEARING ASSEMBLIES

Kilian

AIR MOTORS

Huco

BELTED DRIVES AND SHEAVES

TB Wood's

GEARED CAM LIMIT SWITCHES

Stromag

Altra Industrial Motion

Warner Electric Facilities

North America

31 Industrial Park Road New Hartford, CT 06057 - USA 860-379-1252

Electromagnetic Clutches and Brakes

449 Gardner Street South Beloit, IL 61080 - USA 815-389-3771

4578 East Park 30 Drive Columbia City, IN 46725 - USA 260-244-6183

Precision Electric Coils and Electromagnetic Clutches and

Customer Service

1-800-825-6544

Application Support

1-800-825-9050

Europe

France

7, rue Champfleur, B.P. 20095 St Barthelemy d'Anjou - France +33 (0)2 41 21 24 24

Electromagnetic Clutches and Brakes

Customer Service

+33 (0)2 41 21 24 76

Application Support

+33 (0) 2 41 21 24 24

Asia Pacific

Australia

+61 2 9894 0133

China

+86 21 5169-9255

Hong Kong

+852 2615 9313

Singapore

+65 6487 4464

Taiwan

+886 2 2577 8156

Thailand

+66 2322 5527

The Brands of Altra Industrial Motion

Couplings

Ameridrives

www.ameridrives.com

Bibby Turboflex www.bibbyturboflex.com

Guardian Couplings

www.guardiancouplings.com

Huco www.huco.com

Lamiflex Couplings

www.lamiflexcouplings.com

Stromag

www.stromag.com

TB Wood's

Geared Cam Limit Switches

Stromag

www.stromag.com

Electric Clutches & Brakes

Inertia Dynamics

Matrix www.matrix-international.com

Stromag

www.stromag.com

Warner Electric

www.warnerelectric.com

Linear Products

Warner Linear

www.warnerlinear.com

Engineered Bearing Assemblies

Kilian

www.kilianbearings.com

Heavy Duty Clutches & Brakes

Industrial Clutch www.indclutch.com

Twiflex

www.twiflex.com

Stromag www.stromag.com

Svendborg Brakes

www.svendborg-brakes.com

Wichita Clutch

www.wichitaclutch.com

Belted Drives

TB Wood's

www.tbwoods.com

Gearing

Bauer Gear Motor www.bauergears.com

Boston Gear

www.bostongear.com

Delroyd Worm Gear www.delroyd.com

Nuttall Gear

www.nuttallgear.com

Overrunning Clutches

Formsprag Clutch

www.formsprag.com **Marland Clutch**

www.marland.com

Stieber

www.stieberclutch.com

Neither the accuracy nor completeness of the information contained in this publication is guaranteed by the company and may be subject to change in its sole discretion. The operating and performance characteristics of these products may vary depending on the application, installation, operating conditions and environmental factors. The company's terms and conditions of sale can be viewed at http://www.altramotion.com/terms-and-conditions/sales-terms-and-conditions. These terms and conditions apply to any person who may buy, acquire or use a product referred to herein, including any person who buys from a licensed distributor of these branded products

©2018 by Warner Electric LLC. All rights reserved. All trademarks in this publication are the sole and exclusive property of Warner Electric LLC or one of its affiliated companies.



www.warnerelectric.com P-1316-WE 6/18